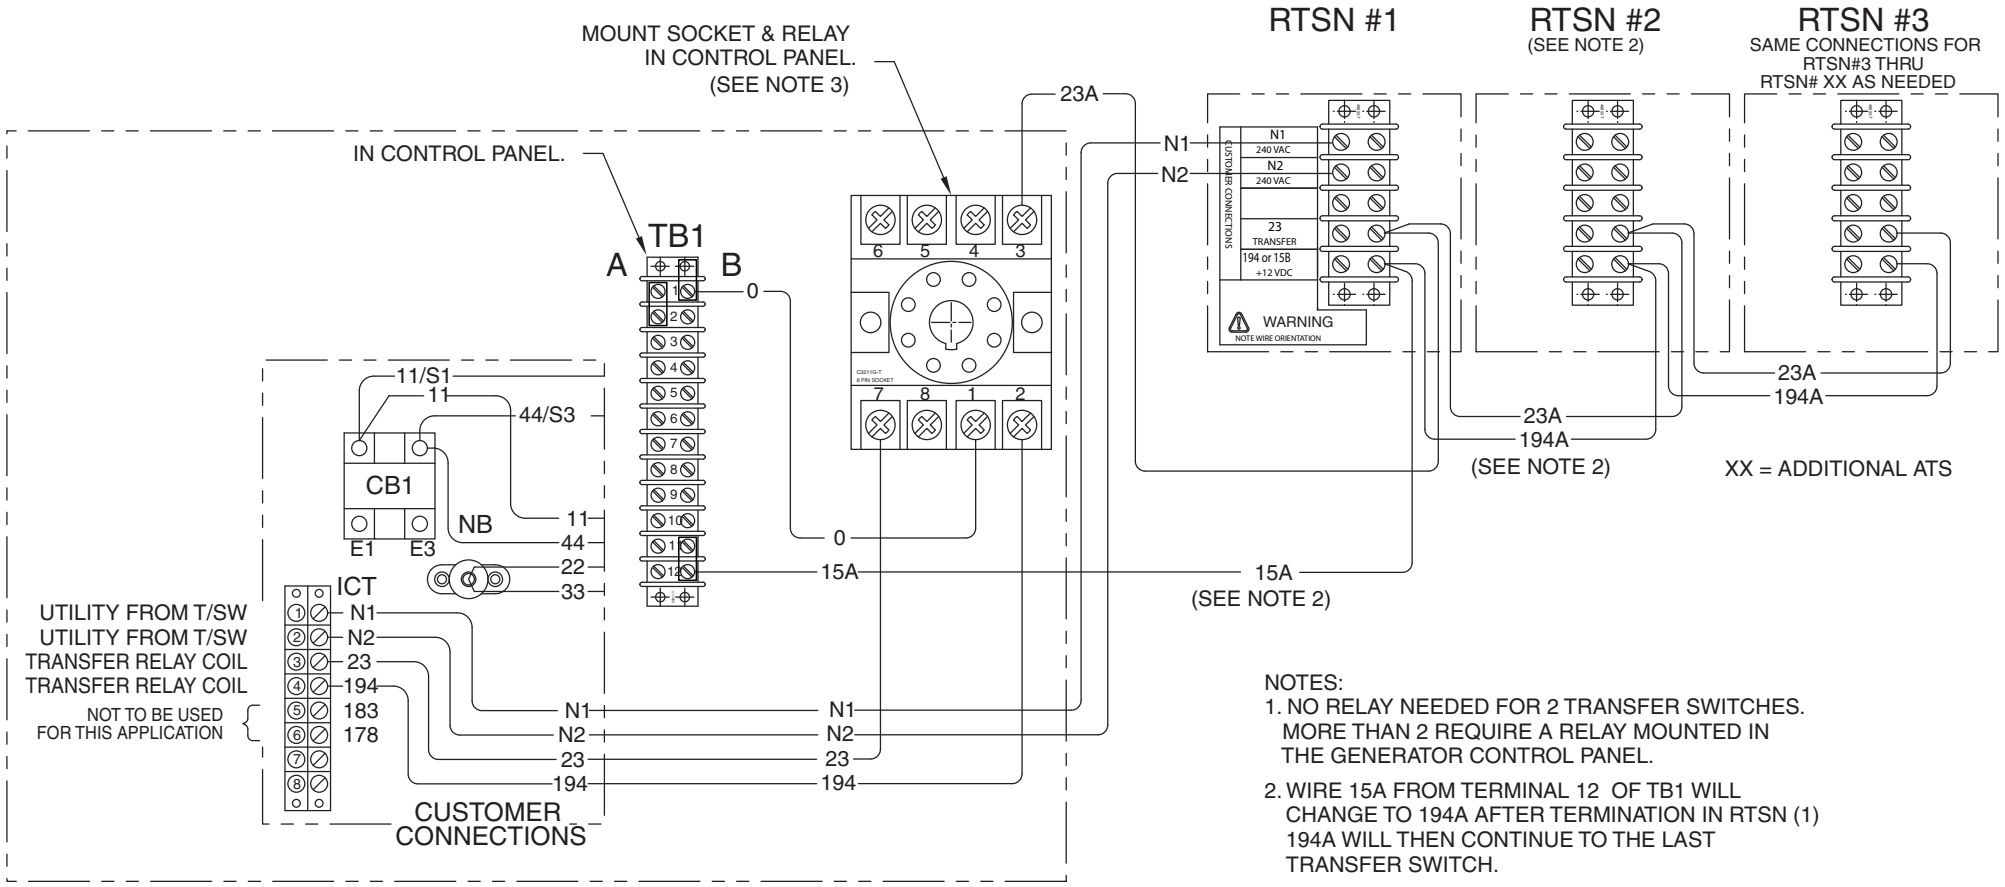

NOTES:

1. NO RELAY NEEDED FOR 2 TRANSFER SWITCHES. MORE THAN 2 REQUIRE A RELAY MOUNTED IN THE GENERATOR CONTROL PANEL.
2. WIRE 15A FROM TERMINAL 12 OF TB1 WILL CHANGE TO 194A AFTER TERMINATION IN RTSN (1) 194A WILL THEN CONTINUE TO THE LAST TRANSFER SWITCH.
3. RELAY - GENERAC PART NO. 0C3211E (12Vdc COIL, CONTACTS RATED 10A@ 240Vac)
   RELAY SOCKET - GENERAC PART NO. 0C3211G (8-PIN OCTAL, 300V)

GENERAC®

INSTALLATION WIRING DIAG.

0H0088-B

MULTIPLE RTSN

ISSUE DATE 08/13/08

Bulletin 0184980SBY rev A / Printed in U.S.A. 10/22/09